





- High Temperature on Request
- Washer load cell
- Range 20 to 320 kN [4 to 64 klbf]
- Ranges compatible with screw dimensions
- High stiffness

DESCRIPTION

Measurement Specialties, Inc.'s washer load cell, model **FMT**, is designed to measure clamping and screwing forces. The sensor design reduces the hysteresis and sensitivity variations associated with torque generated by friction during tightening. The **FMT** has a high stiffness and can be used in static and dynamic applications.

With many years of experience as a designer and manufacturer of sensors, Measurement Specialties, Inc. often works with customers to design or customize sensors for specific uses and testing environments.

To meet your needs we also offer complete turnkey systems. The matched components (sensor, power, amplifier and digital display) are formatted, calibrated and ready for immediate use.

FEATURES

- Screw dimensions
- Compression
- For Static and Dynamic Applications
- Support Washer Provided

APPLICATIONS

- Monitoring Blot Clamping for Bridges
- Process Control Equipment
- Robotics and Effectors
- Laboratory and Research

STANDARD RANGES

Model	FMT6	FMT8	FMT10	FMT12	FMT14	FMT16	FMT18	FMT20	FMT22	FMT24
Ranges in N	20k	35k	55k	80k	110k	140k	180k	220k	270k	320k
Ranges in lbf	4k	7k	11k	16k	22k	28k	36k	44k	54k	64k

PERFORMANCE SPECIFICATIONS

All values are typical at temperature 20 ±1℃

PARAMETERS					
Operating Temperature Range (OTR)	-20 to 80°C [-4 to 176°F]				
Compensated Temperature Range (CTR)	0 to 60°C [32 to 140°F]				
Zero Shift in CTR	<0.5% F.S. / 50°C [/100°F]				
Sensitivity Shift in CTR	<1% of reading / 50°C [/100°F]				
Range (F.S.)	0-20 to 320 kN [4 to 64 klbf]				
Over-Range					
Without Damage	1.5 x F.S.				
Without Destruction	3 x F.S.				
Accuracy					
Combined Non-Linearity & Hysteresis	From 1-5% F.S.				


Electrical Characteristics


Model	FMT					
Supply Voltage	10Vdc					
F.S. Output	1.5mV/V					
Zero Offset	±5% F.S.					
Input Impedance	700Ω					
Output Impedance	700Ω					
Insulation under 50Vdc	≥100MΩ					

Notes

- 1. Electrical Termination: Shielded cable, standard length 2 m [6.5 ft] with strain relief spring
- 2. Materials:Body in stainless steel, cover in aluminium alloy
- 3. Support Washer: Steel
- 4. CE conformance according to EN 61010-1, EN 50081-1, EN 50082-1

DIMENSIONS & WIRING SCHEMATIC (IN METRIC AND IMPERIAL)

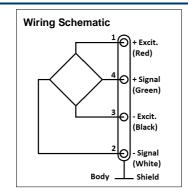


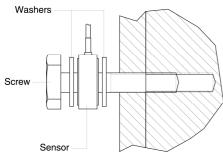

Safe practice:

Due to the FMT's small size and stiffness, a certain number of mounting precautions should be observed during installation:

- The force should be uniformly distributed over the surface of the sensor.
- Surfaces in contact with the sensor should be uniform and parallel.
- We recommend that washers (supplied by MEAS) be mounted between the surfaces and the sensor so that the washers are crushed during tightening. This helps to distribute the force more evenly. Linearity response is function of this caution.

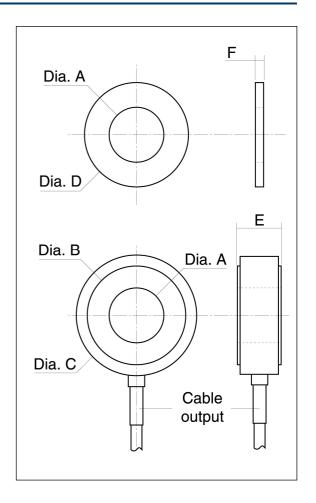


Dimensions in mm [inch]

Model	FMT6	FMT8	FMT10	FMT12	FMT14	FMT16	FMT18	FMT20	FMT22	FMT24
Ranges in N	20k	35k	55k	80k	110k	140k	180k	220k	270k	320k
[in lbf]	[4k]	[7k]	[11k]	[16k]	[22k]	[28k]	[36k]	[44k]	[54k]	[64k]
А	6.1	8.1	10.1	12.1	14.1	16.1	18.1	20.1	22.1	24.1
	[0.24]	[0.32]	[0.40]	[0.48]	[0.56]	[0.63]	[0.71]	[0.79]	[0.87]	[0.95]
В	11	14.5	18	22	25.5	29	32.5	36	40	43.5
	[0.43]	[0.57]	[0.71]	[0.87]	[1.00]	[1.14]	[1.28]	[1.42]	[1.57]	[1.71]
С	18	21	25	29	32	36	39	43	48	50
	[0.71]	[0.83]	[0.98]	[1.14]	[1.26]	[1.42]	[1.54]	[1.69]	[1.89]	[1.97]
D	12.7	19	22	25	28	32	34	38	44	48
	[0.50]	[0.75]	[0.87]	[0.98]	[1.10]	[1.26]	[1.34]	[1.50]	[1.73]	[1.89]
E	6.5	10	11	11.5	12.5	13.5	15	16	17	19
	[0.26]	[0.39]	[0.43]	[0.45]	[0.49]	[0.53]	[0.59]	[0.63]	[0.67]	[0.75]
F	1.5	1.5	2	2	2	3.2	3.2	3.2	3.2	3.2
	[0.06]	[0.06]	[0.08]	[0.08]	[0.08]	[0.13]	[0.13]	[0.13]	[0.13]	[0.13]

OPTIONS

L00M: special cable length, replace "00" with total length in meters.

ORDERING INFO



联系方式



广东省深圳市南山区创业路怡海广场东座2407 邮编:518000 电话:+86 755 2641 9890 传真:+86 755 2641 9680

电子邮箱:sales@bill-well.com